



THE SAFETY BOX

A newsletter dedicated to keeping our children safe

Louisiana Department of Justice ♦ James D. "Buddy" Caldwell, Attorney General ♦ Consumer Protection Section ♦ Winter 2013/2014

This newsletter is printed quarterly in accordance with the Louisiana Children's Product Act, La. R.S. 46:2701-2711. For more information on recalled children's products, consumers may visit our website at www.agbuddycaldwell.com, click on "News and Publications," or call our toll-free **CONSUMER INFO LINE** at (800) 351-4889. Information about child product recalls and toy hazard recalls included in this newsletter was received from the **Consumer Product Safety Commission (CPSC)**. Consumers may visit their website at www.cpsc.gov for product recall information and product safety information. The recall information included in this newsletter is for November 2013 through February 2014.

TOY PRODUCT RECALLS

PRODUCT/FIRM: Doodlebutt Jelly BeadZ Jumbo BeadZ and Magic Growing Fruity Fun Toys

BRAND/MODEL: This recall involves Doodlebutt Jelly BeadZ Jumbo BeadZ and Magic Growing Fruity Fun water-absorbing polymer toys. The toys can absorb from 300 to 500 times their weight in water and can grow up to eight times their original size. Jumbo BeadZ toys are marble-sized water-absorbing



balls. They were sold in a package consisting of three separate 2.5-inch x 2-inch clear, resealable bags inside a 3.5-inch x 4-inch clear, resealable bag. Each smaller bag had eight to 12 water balls of slightly different sizes. The balls came in clear, blue, red, orange, yellow, green and purple colors. The front of the larger bag had a multi-colored label with the words "Jelly BeadZ," "Easy to follow directions" and had instructions for use. Magic Growing Fruity Fun toys are water-absorbing polymers in the shapes of apples, bananas, butterflies, cherries, grapes, pineapples, roses and strawberries. They were sold in 3.5-inch x 4-inch, clear, resealable bag with seven assorted shapes in it. They came in blue, green, orange, pink, red and yellow. The label on the front of the bag has the words "For 'Kidz' of All Ages," "Jelly BeadZ," "Bouncy and Beautiful," "Colorfast," "Non Toxic," "Safe for the Environment," and other words that describe uses for the product. The back of the package has two smaller labels. One label contains instructions for use and the other has a barcode with "XU00EC1JRN" beneath it.


PROBLEM: These soft and colorful products can be mistaken by a child for candy. When swallowed, they can expand inside a child's body and cause intestinal

obstructions, resulting in severe discomfort, vomiting, dehydration and could be life threatening. Similar toys have not shown up on x-rays and needed surgery to be removed from the body.

REMEDY: Consumers should immediately stop using the recalled polymer products and take them away from small children. Consumers should contact Doodlebutt for a full refund. Contact Doodlebutt collect at (239) 313-9779 from 9 a.m. to 5 p.m. Monday through Friday or at e-mail whitmana@live.com.

PRODUCT/FIRM: Infantino Teething Toys

BRAND/MODEL: This recall involves the Go Gaga Squeeze & Teethe Coco the Monkey teething toys. This squeaking toy is made of soft orange rubber and is shaped like a monkey. The toy measures 4.5 inches tall by 5 inches long and is intended for ages newborn and up. "Infantino" is marked on the back toward

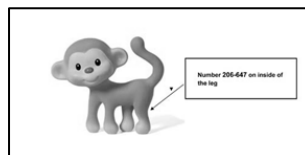


the rear and model number 206-647 is marked on the inside of the rear left leg.

PROBLEM: The tail of the monkey can pose a choking hazard to young children.

REMEDY: Consumers should immediately take the recalled products away from infants and contact Infantino to receive a free replacement toy. Contact Infantino at (888) 808-3111 between 8 a.m. and 4 p.m. Monday through Friday or online at www.infantino.com and click on Recall Information on the home page.

PRODUCT/FIRM: A Harvest Company Cork Block Stacking Toys

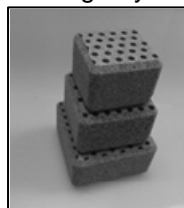

BRAND/MODEL: This recall involves a three-piece cork block stacking toy. Each of the square cork blocks are a different size: 2 7/8 inch by 2 7/8 inch, 2 3/8 inch by 2 3/8 inch and 2 inch by 2 inch. All of the blocks are 1 1/2 inches tall. The blocks have black

dots on the top. The packaging is labeled "6mo+" for use by children six months and older.

PROBLEM: Small pieces of cork can break off the blocks, posing a choking hazard to young children.

REMEDY: Consumers should immediately stop using the recalled cork block toys and contact A Harvest Company for instructions to return the block sets for a merchandise credit. Contact A Harvest Company at (877) 394-7774 from 8 a.m. to 5 p.m. Monday through Friday, or visit the firm's website at www.aharvestcompany.com and click Cork Stacker Blocker Sets Recall for more information.

PRODUCT/FIRM: Manhattan Toy® Quixel™ Baby Rattles

BRAND/MODEL: This recall includes the Manhattan Toy® Quixel™ baby rattle. The plastic rattles have four, colored arches (red, orange, green and blue) with sliding beads on each of the arches. The arches are held together by a single string of red, white and blue elastic. The rattle arches measure about 5 inches in diameter. The product was sold with or without a box. "Manhattan Toy" is printed on one of the arches.



PROBLEM: The colored arches can break, creating a small part which poses a choking hazard to small children

REMEDY: Consumers should immediately take these rattles away from young children and return it to the store where purchased for a full refund. Contact Manhattan Group at (800) 541-1345 from 8 a.m. to 5 p.m. Monday through Friday, or online at www.manhattantoy.com and click on RECALLS at the bottom of the home page for more information.

CHILD PRODUCT RECALLS

PRODUCT/FIRM: Step 2 Whisper Ride Touring Wagon



BRAND/MODEL: This recall involves Step2® Whisper Ride Touring Wagons. The two-seat plastic wagon is 25-inches wide by 41.25-inches long by 20-inches high with blue seats, a tan wagon base and a red canopy. The Step2 logo appears on the canopy and on

the side of the wagon base.

PROBLEM: The removable blue seat backs can detach and allow the child in the wagon to fall out, posing a fall hazard.

REMEDY: Consumers should immediately stop using the wagon and inspect it to determine if the seat belt is

attached to the removable blue seat back. If so, the wagon is included in this recall. Consumers with the recalled wagons should contact Step2 to obtain a free repair kit. Contact Step2 at (866) 860-1887 between 8 a.m. and 5 p.m. Monday through Friday or visit the firm's website at www.step2.com and click on "Product Recall" for more information.

PRODUCT/FIRM: Vans Boy's Hooded Jacket



BRAND/MODEL: This recall involves Vans' AV Edict hooded jackets for boys. They were sold in boy's sizes S, M, L and XL and made from black cotton or black canvas with a drawstring through the hood. "Vans®" is printed on a tab above the jacket's left front pocket. An

intertwined "AV" logo is embroidered in black beneath the lower right pocket and also appears on the jacket's snaps. "Vans®," "OFF THE WALL®" and an intertwined "AV" logo is sewn on a label inside neck of the jacket.

PROBLEM: The jackets have drawstrings in the hood around the neck area that pose a strangulation hazard to young children. In February 1996, CPSC issued guidelines about drawstrings in children's upper outerwear. In 1997, those guidelines were incorporated into a voluntary standard. Then, in July 2011, based on the guidelines and voluntary standard, CPSC issued a federal regulation.

REMEDY: Consumers should take the recalled jackets away from children and return them to the place of purchase for a full refund or for a repair. Contact Vans Inc. at (800) 817-0618 anytime or online at www.vans.com and click on Recall Info for more information.

PRODUCT/FIRM: Wood Castle Furniture Riley Duo Bunk Beds

BRAND/MODEL: This recall involves Riley Duo model bunk beds with model number C 5702, E 5702 or M 5702. The Duo has a twin size mattress frame on top



and a full size mattress frame on the bottom. The solid wood bunk bed was sold in cherry, eastern maple or pacific coast maple. A warning label on the end rail of the top bunk has model number "5702" and "Duo Bunk" printed on it.

PROBLEM: The openings between the guardrails on the bunk bed can exceed 3 ½ inches in width, which is too wide and does not meet safety standards. This presents an entrapment hazard where a child could be seriously injured or become asphyxiated.

REMEDY: Consumers should immediately contact Wood Castle Furniture for a free repair. Either the consumer or a company representative can determine if the guardrails spacing is too wide. Consumers with young children should discontinue use of the bunk bed until the hazard has been remedied. Contact Wood Castle Furniture collect at (571) 754-9304 from 8 a.m. to 5 p.m. Monday through Friday or online at

www.woodcastle.com and click on Product Recall for more information.

PRODUCT/FIRM: Babycottons Children's Nightgown
BRAND/MODEL: This recall involves Babycottons children's 100% cotton nightgowns sold in sizes 24 months through toddler size 6. The nightgowns were sold in six prints including Alphabet (style 1413W245), BC Flowers (style 1413S220), Fairies (style 1413W125), Fairies Dots (style 1413W127), Mei Mei (style 1413S200) and Summertime (style 1413S190). The style numbers are



printed on a hangtag attached to the garments. The white Alphabet gown has long sleeves with an alphabet print and image of an item beginning with that letter. The white and peach BC Flowers gown has the initials "BC" printed in the middle of the chest with a flower vines print. The white Fairies gown has long sleeves white pink fairies. The Fairies Dots gown has long sleeves with a white polka dot and solid pink background and a fairy applique in the center with a white ribbon. The white and pink polka dots Mei Mei gown has short sleeve with two girls printed on the center of the chest. The white Summertime gown has short sleeves with girls swimming in a coral and fish print. All of the gowns have ruffles on the sleeves, neck or bottom.

PROBLEM: The nightgowns fail to meet federal flammability standards for children's sleepwear, posing a risk of burn injuries to children.

REMEDY: Consumers should immediately take the recalled nightgowns away from children and return to Babycottons for a full refund. Contact Babycottons at (855) 922-2437 from 9 a.m. to 5 p.m. Monday through Friday or online at www.babycottons.com and click on the Product Recall link on the bottom of the page for more information.

PRODUCT/FIRM: L.L. Bean Girl's Pajama Set

BRAND/MODEL: The recall includes Girl's or Little Girl's jersey knit aurora purple pajama sets sold by L.L. Bean. The sets have a solid purple top with long sleeves and purple pants with a pattern and a solid purple waistband. The pajamas were sold in girls sizes small (size



8) through extra large (size 18) and little girls sizes small (size 4) through large (6X/7). The pajamas product ID numbers included in the recall are 284889 and 284890 printed on the second side seam label under the care label. GPU#6 is also printed on the garment label located on the inside left seam near the bottom of the pajama top. L.L. Bean is printed inside the back of the neck of the garment.

PROBLEM: The pajama sets fail to meet the federal flammability standard for children's sleepwear, posing a risk of burn injuries to children.

REMEDY: Consumers should immediately take the recalled pajama sets away from children and contact

L.L. Bean to receive a free replacement, a full refund or store gift certificate. Contact L.L. Bean at (800) 555-9717 from 8 a.m. to 10 p.m. Monday through Friday or online at www.llbean.com and click the bottom right of the homepage "Product Recall & Safety Info" for more information.

PRODUCT/FIRM: Dream on Me Lullaby Cradle Glider
BRAND/MODEL: This recall involves the Lullaby Cradle Glider manufactured by Dream On Me Inc. The cradle is made of solid pine with slats on all four sides and a base that has a gliding side-to-side motion. The inner dimensions of the cradle measure 34.5 inches by 20.5 inches and includes a mattress pad and four wheels for easy movement. The cradle is sold



in one design, four colors 640-C, cherry; 640-W, white; 640-E, espresso; and 640-N, natural. A label identifying the date of manufacture as October 2011 is located on the mattress support board.

PROBLEM: The mattress support board can fall out or slide out of the bottom of the cradle glider posing a risk that babies can fall out and suffer injuries.

REMEDY: Consumers should immediately stop using the recalled cradles and contact Dream On Me to obtain a free repair kit. Instructions for assembly will be included in the repair kit. Contact Dream On Me at (877) 201-4317 from 9 a.m. to 5 p.m. Monday through Thursday and 8 a.m. to 4 p.m. Friday or online at www.dreamonme.com and click on the Recalls tab for more information.

PRODUCT/FIRM: The Bailey Boys Boy's Loungewear Pants



BRAND/MODEL: This recall involves The Bailey Boys' children's 100% cotton loungewear pants, sold in sizes toddler 2 through boys' 12. All of the pajama pants have an elastic waistband with a white drawstring and a garment label that states "J.Bailey clothing for young men." The pajama pants were sold in multiple prints including Chad-Ball red baseball print, Chad-Base two colored red baseball print, Chad-Boat light blue boat print, Chad Crab grey crab print, Chad-Golf light gray print, Chad-Santa green Santa Clause print, Chad-Sea grey blue seahorse print, Chad-Turtle dark blue turtle print and Chad-Turtle light blue turtle print. The website www.jbaileyclothing.com is printed on a hangtag attached to the garment.

PROBLEM: The pajama pants fail to meet federal flammability standards for children's sleepwear, posing a risk of burn injuries to children.

REMEDY: Consumers should immediately take the recalled pajama pants away from children, and return them to The Bailey Boys, Inc. for a full refund. Contact The Bailey Boys, Inc at (855) 809-4400 from 9 a.m. to 5 p.m. Monday through Friday or online at

www.baileyboys.com and click on the Product Recall link at the bottom of the page for more information.

PRODUCT/FIRM: Angelcare Movement and Sound Baby Monitors

BRAND/MODEL: The recall involves the Movement and Sound Monitor manufactured by Angelcare. This design of baby monitor includes a unique sensor pad placed inside the crib, under the mattress, to monitor movement of the baby. An electrical cord about 11 feet long is permanently connected from the sensor pad to the nursery monitor unit. The hazard is created by a cord within reach of a baby




inside the crib. The cord can be pulled into the crib and can wrap around the child's neck. The recall involves all versions of Angelcare sensor monitors including model numbers: AC1100, AC201, AC300, AC401 AC601 and 49255 that did not include rigid cord covers, offered in the remedy. The model number is located on the back of the nursery monitor unit. The monitors were manufactured between 1999 and 2013.

PROBLEM: The cord attached to the baby monitor's sensor pad is placed under the crib mattress, which poses a strangulation risk if the child pulls the cord into the crib and it becomes wrapped around the neck.

REMEDY: Contact Angelcare at (855) 355-2643 from 8 a.m. to 8 p.m. Monday through Friday, e-mail at Consumers@angelcare.ca or online at <http://www.angelcarebaby.com> and click on the safety notice section of the website for more information.

PRODUCT/FIRM: Tailwind Bicycle Racks for Trailercycles


BRAND/MODEL: The Tailwind Racks are used for hitching children's trailercycles to adult size bicycles. The aluminum racks were sold individually, in black or silver, or with Kazoo or Piccolo brand trailercycles in black only. The individual racks have stock code numbers 939001 for black

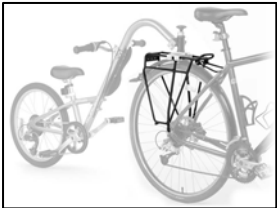

and 939002 for silver, which was printed on the original packaging. The racks have double side rails. Burley is printed on the curved back plate of the rack.

PROBLEM: The top portion of the tailwind rack that connects trailercycles to a towing bicycle can break and allow the trailercycle to disconnect, posing a fall hazard.

REMEDY: Consumers should stop using the Tailwind Racks immediately and contact Burley to receive a free replacement rack. Burley will replace recalled Tailwind Racks with a steel Moose Rack. Contact Burley Design at (800) 311-5294 between 8 a.m. and 5 p.m. Monday through Friday or online at www.burley.com and click on Recall Information for more information.

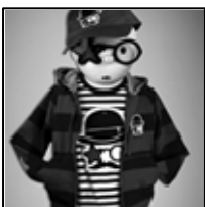

PRODUCT/FIRM: Little Willy's Hooded Sweatshirts

BRAND/MODEL: This recall involves Little Willy's brand children's hooded sweatshirts sold in sizes XS (2 years), S (3 years), M (4-5 years), L (6-7 years), XL (8-9 years) and XXL (10 years). The cotton fleece sweatshirts were sold in two color patterns: dark grey with light grey stripes and a red hood, and purple with navy blue stripes and a green hood. The sweatshirt has an elbow patch on the right arm and the Little Willy logo on the front.

PROBLEM: The hoodies have drawstrings through the hood or neck which pose a strangulation hazard to young children. In February 1996, CPSC issued guidelines about drawstrings in children's upper outerwear. In 1997, those guidelines were incorporated into a voluntary standard. Then, in July 2011, based on the guidelines and voluntary standard, CPSC issued a federal regulation.

REMEDY: Consumers should immediately take the garments away from children. Consumers can remove the drawstrings to eliminate the hazard or return the garments to Little Willy's to have the drawstring removed. Contact Little Willy's collect at (212) 680-0107 from 11 a.m. to 7 p.m. Tuesday through Saturday, or online at www.littlewillys.com. In addition, consumers can email mr.wilcox@lordwillys.com for more information.

PRODUCT/FIRM: American Boy and Girl Girl's "Susan" Sandals

BRAND/MODEL: This recall involves infant girl sandals sold under the Falls Creek Baby brand. The "Susan" style was sold in infant sizes 3 to 6 months, 6 to 9 months and 9 to 12 months. The white leather sandals have three pink, purple and yellow flowers on the top and a top strap that attaches to a hook and loop fastener on each side of the shoe. "Falls Creek Baby" and the size are printed on the inside of the shoe.




PROBLEM: The top strap can be pulled loose from the shoe, posing a choking hazard to the child.

REMEDY: Consumers should immediately take the recalled sandals away from children and contact American Boy and Girl for a refund or replacement. Contact American Boy and Girl at (800) 689-9237 from 9 a.m. to 4 p.m. Monday through Friday, or online at www.abgnyc.com, and click on "Recall Information" for more information.

PRODUCT/FIRM: K2 Revo Kick Kickboards/Scooters

BRAND/MODEL: This recall involves K2 Revo Kick kickboards/scooters with item code 110700100. Revo Kick and the item code are printed on a sticker on the underside of the deck. The kickboard/scooter is made of aluminum, has three wheels, a wooden deck and a vertical handle with a round grip. The kickboards/scooters measure about 32 inches long and 40 inches high. The deck has a red, white and blue design with K2 printed on it.

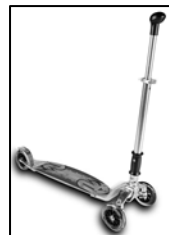

PROBLEM: The front assembly of the kickboards/scooters can break and the handle can detach or partially detach, causing loss of control or loss of balance. This poses a fall hazard to the rider.

REMEDY: Consumers should immediately stop using the recalled kickboards/scooters and contact K2 Sports for a full refund. Contact K2 Sports at (866) 302-9996 from 7 a.m. to 5 p.m. Monday through Friday, email the firm at kickboard@k2sports.com or online at www.k2sports.com and click on Important Safety Information for more information.

PRODUCT/FIRM: Wearever Girl's Long Sleeve Hooded Jacket and Pant Sets



BRAND/MODEL: This recall includes Wearever Girl brand girl's long sleeve zip-up 100% cotton hooded jackets sold as a set with brown pants. The brown hooded jackets have thin aqua, light pink and light green horizontal stripes and sold in girl's sizes 7 to 16. There is a brown, flat drawstring around

the neck of the jackets. "Wearever Girl" is printed on a label on the back inside neck of the jackets and on the pants.

PROBLEM: The jackets sold with the set have drawstrings through the hood which pose a strangulation hazard to young children. In February 1996, CPSC issued guidelines for children's upper outerwear. In 1997, those guidelines were incorporated into a voluntary standard. Then, in July 2011, based on the guidelines and voluntary standard, CPSC issued a federal regulation.

REMEDY: Consumers should immediately take the jackets away from children and remove the drawstrings to eliminate the hazard. Consumers can also contact David's Place to obtain a return address label and instructions for returning the garment for a full refund. Contact David's Place Off Price Clothing toll-free at (888) 394-1398 from 8:30 a.m. to 5 p.m. Monday through Friday or e-mail at dania@ymijean.com for more information.

PRODUCT/FIRM: Solowave Tornado brand home playground tube slides with port holes

BRAND/MODEL: This recall involves Solowave Tornado brand home playground tube slides with port holes. The slides are green, six or seven feet long and have three or five port hole-style plastic windows in the sides. The slides were sold with Solowave's Centennial, Centennial II, Lexington, Rocky Mountain Deluxe and Sheridan play systems and were also sold separately. Solowave Design is stamped on the outside of



the slides near the middle of each tube slide section.

PROBLEM: The plastic port hole-type windows in the tube slide can break, posing a laceration hazard to children.

REMEDY: Consumers should stop using the recalled slide immediately and contact Solowave to receive a free repair kit for the port hole windows. Contact Solowave toll-free at (866) 678-0376 between 9 a.m. and 5 p.m. Monday through Friday, or online at www.solowavedesign.com and click on Important Safety Notice for more information.

PRODUCT/FIRM: Ram's Imports IQ Girls' Hooded Pink Leopard Jackets



BRAND/MODEL: This recall involves girls pink hooded jackets. The jacket is 97 % cotton 3% spandex. The jackets have pink and black leopard print drawstrings and pink and black leopard print on the sides of the jacket. "IQ girls" is printed on the sewn-in label located on the back of the neck. The model number included in the recall is 86557 and can be found printed on a sewn in label in the back of the neck. This recall involves jacket sizes girls 4 through 12.

PROBLEM: The jackets have a drawstring through the hood which can pose a strangulation hazard to children. In February 1996, CPSC issued guidelines about drawstrings in children's upper outerwear. In 1997, those guidelines were incorporated into a voluntary standard. Then, in July 2011, based on the guidelines and voluntary standard, CPSC issued a federal regulation.

REMEDY: Consumers should immediately remove the drawstrings from the garment to eliminate the hazard or return the garment to Ram's Imports Inc. for a full refund. Contact Ram's Imports toll-free at (855) 346-5950 between 10 a.m. and 5 p.m. Monday through Friday or online at www.ramsimports.com and click on "product recall" for additional information.

PRODUCT/FIRM: IKEA Children's wall-mounted lamps

BRAND/MODEL: The recalled IKEA children's SMILA-series wall-mounted lamps were sold in eight designs, including a blue star, yellow moon, pink flower, white flower, red heart, green bug, blue seashell and an orange seahorse. The blue star is the STJÄRNA model with article numbers 501.944.49 or 500.108.79. The yellow moon is the MÅNE model with article numbers 701.944.48 or 700.108.40. The pink flower is the BLOMMA model with article numbers 901.944.47 or 000.979.50. The white flower is the BLOMMA model with article number 300-746-50. The red heart is the HJÄRTA model with article numbers 202.256.59 or 801.993.13. The green bug is the BAGGE model with article numbers 101.944.46 or 700.728.71. The blue seashell is the SNÄCKA model with article number 400-982-50. The orange seahorse is the SJÖHÄST model with article number 900-982-43.



PROBLEM: A 16-month-old child in a crib died after getting entangled in the lamp's cord. In a separate incident, a 15-month-old child in a crib became entangled in the lamp's cord and nearly strangled. In both incidents, which occurred in Europe, the lamp cord

was pulled into the crib by the infants, creating a strangulation hazard.

REMEDY: Contact IKEA toll-free at (888) 966-4532 anytime or online at www.ikea-usa.com and click on the Recall link at the top of the page for more information.

PRODUCT/FIRM: Mirage Fashions Yoki Girl's Faux Leather Jacket

BRAND/MODEL: This recall involves girl's hooded faux leather jackets with a zipper front closure and bearing a Yoki Girls label at the neck. They were sold in girl's sizes 7 through 16. The jacket comes in black or charcoal, with drawstrings through the neck area. The coats have snap button pockets on each side and a zippered pocket on the top left chest area. Both the black and charcoal colored jackets have a grey hood. Style number JK2503G is on the product care label located on the lower left inside seam.



PROBLEM: The jackets have a drawstring through the hood which can pose a strangulation hazard to children. In February 1996, CPSC issued guidelines about drawstrings in children's upper outerwear. In 1997, those guidelines were incorporated into a voluntary standard. Then, in July 2011, based on the guidelines and voluntary standard, CPSC issued a federal regulation.

REMEDY: Consumers should immediately remove the drawstrings from the garment to eliminate the hazard or return the garment to Mirage Fashions for a full refund. Contact Mirage Fashion's at (855) 221-5888 from 9 a.m. to 3 p.m. Monday through Friday or by e-mail at Recalls@yokisport.com for additional recall information.

PRODUCT/FIRM: Playtex Hip Hammock Infant Carriers

BRAND/MODEL: The Playtex Hip Hammock is an infant carrier designed to strap the baby against the caregiver's body at the hip. It is made of a soft, quilted fabric and intended for babies that are from 15 to 35 pounds. The child seat is attached with straps that wrap around the carrier's hips and shoulder. "Playtex Hip Hammock" is printed on a label sewn into the front of the carrier.



All model numbers are being recalled. Model numbers 05300, 05301, 05302, 05306, 05307 and 05308 are sewn into the inside panel below the instructions for use. They come in basic and deluxe styles. The hip hammock's fabric is suede or ultra-suede in black or navy colors on the outside, and the inside lining is black, black and white check or burgundy.

PROBLEM: The buckles on the waist and shoulder straps can crack or break, posing a fall hazard to the child.

REMEDY: Consumers should stop using the carrier and contact Playtex for instructions on how to return the product for a full refund. Contact Playtex at (800) 522-8230 from 8 a.m. to 6 p.m. Monday through Friday or online at www.playtexproducts.com and click on Recall for more information.

PRODUCT/FIRM: Cubetensils Children's Eating Utensils

BRAND/MODEL: This recall involves Edoche's Cubetensils sets of children's eating utensils. Each set consists of a spoon and a matching fork with stainless steel heads and plastic handles. The handle has three segments that rotate to create design combinations. The utensils are 5.75-inches long and were sold in seven different models/designs: alphabet, moon and stars, nature, princess, rockets, trucks




and veggies. The sets come in a brown cardboard box with a clear viewing window in the front. "Edoche" is printed on the bottom of the utensils and "Stainless Steel China" is embossed on the metal heads. The phrase "Not for children under 3" appears on the back of the product's packaging.

PROBLEM: The utensil's handle can detach, posing a choking hazard to infants.

REMEDY: Consumers should immediately take the utensils away from children and contact Edoche for a full refund. Contact Edoche and call collect at (774) 295-0170 from 9 a.m. to 5 p.m. Monday through Friday or online at www.edoche.com then click on About Us at the top of the page for more information. Customers can also send an email to info@edoche.com.

PRODUCT/FIRM: Joovy Zoom Car Seat Stroller Adapter

BRAND/MODEL: This recall involves all Joovy's Zoom gray metal car seat stroller adapters. The adapters are gray with black plastic clips designed to attach infant car seats to stroller frames. The adapter frame's dimensions are approximately 17" x 13" x 10". Recalled car seat adapter models include 00945 for Graco, 00946 for Chicco and 00947 for Peg

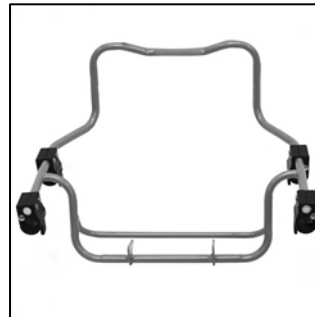

Perego frames. "Joovy" and the model numbers can be found on the label at the center of the end bar of the adapter.

PROBLEM: Adapter clips can loosen on the stroller frame, posing a fall hazard.

REMEDY: Consumers should stop using these adapters and contact Joovy for a free repair kit to help assure proper attachment to Zoom stroller frames. Contact Joovy toll-free at (855) 251-0759 from 8 a.m. to 5 p.m. Monday through Friday or online at www.joovy.com, then click on the "Customer Service" menu at the top of the page, then select "Recall Information" for more information.

PRODUCT/FIRM: Under Armour Infant Sports Jersey Kits

BRAND/MODEL: The infant home kit consists of a white jersey and navy blue shorts and socks in sizes 0, 6 months, 12 months and 18 months. The jersey has style



#1238534 printed on a side seam label. The jerseys are white with navy blue trim and navy blue UA and Tottenham Hotspur logos. The navy blue shorts have white trim and white UA and Tottenham Hotspur logos. The socks are navy blue.

PROBLEM: The shoulder snaps on the jersey can detach, posing laceration and choking hazards.

REMEDY: Consumers should immediately take the recalled home kits away from children and return the kits to the retailer where purchased or contact Under Armour for a full refund. Contact Under Armour at (888) 823-0343 from 8 a.m. through 6 p.m. Monday through Friday or online at www.underarmour.com and click on Recall for more information.

PRODUCT/FIRM: Midwest-CBK Baby Rattles

BRAND/MODEL: This recall involves donut-shaped polyester knit fabric baby rattles with heads and arms to resemble a bear, monkey and a lion. They measure about 7 inches in diameter by 2 inches thick. Sweet-ums and Midwest-CBK are printed on a hang tag on the rattles. A label sewn into the rattles has Midwest-CBK, the



production date 04/2013 and the batch #:00001281 printed on it.

PROBLEM: The head on the rattle can detach, posing a choking hazard to young children.

REMEDY: Consumers should take the recalled rattles away from young children immediately and contact Midwest-CBK for a full refund. Contact Midwest-CBK at (800) 394-4225 from 8 a.m. to 5 p.m. Monday through Friday or online at www.mwcbk.com and click on Product Recall Information.

PRODUCT/FIRM: Playtex Pacifier Holder Clips

BRAND/MODEL: This recall involves the Playtex pacifier holder clips that attach a pacifier to items like clothing, diaper bags and strollers. It is a plastic clip with a figure and a "Playtex" copyright logo that slides up and down to adjust the clip, a ribbon and a clear plastic ring that stretches to fit the pacifier. The pacifier holder was sold in green with a monkey figure, pink with a flower and blue with a tow truck.



PROBLEM: The pacifier holder clips can crack and a small part can break off which poses a choking hazard to small children.

REMEDY: Consumers should immediately take the recalled pacifier holders away from infants and contact Playtex for instructions on how to return the product for a full refund. Contact Playtex toll-free at (888) 220-2075 from 8 a.m. to 6 p.m. Monday through Friday or online at www.playtexproducts.com and click on Recall for more information.

PRODUCT/FIRM: IKEA KRITTER and SNIGLAR Junior Beds

BRAND/MODEL: Recalled IKEA junior beds include the KRITTER and SNIGLAR



models with a guard rail on one side. The pine wood KRITTER beds have animal cut-outs, such as a dog and cat on the headboard. A label on the


headboard or underside of the KRITTER bed has a date stamp of 1114 to 1322 representing the year and week of production (YYWW), a 600.904.70 model number, and 19740 supplier number. The SNIGLAR natural beech wood beds have a white painted fiberboard insert on the headboard and footboard of the bed. A label on the headboard or underside of the SNIGLAR bed has a date stamp of 1114 to 1318 (YYWW), a 500.871.66 model number, and 18157 supplier number. This recall expands the date stamp for SNIGLAR beds to 1049 to 1318. The beds measure about 65 inches long by 30 inches wide with a 22 to 26 inch high headboard.

PROBLEM: The metal rod connecting the guard rail to the bed frame can break in use, posing a laceration hazard.

REMEDY: Consumers should immediately stop using the recalled KRITTER and SNIGLAR junior beds and contact IKEA to receive a free repair kit. Contact IKEA toll-free at (888) 966-4532 anytime or online at www.ikea-usa.com and click on the recall link on the top of the page for more information.

PRODUCT/FIRM: Fred & Friends Infant Pacifiers

BRAND/MODEL: This recall involves three styles of Fred & Friends Chill Baby pacifiers, including the Artiste with a black plastic beard and mustache, Volume with a black volume control knob and Panic with a red panic button. The pacifier's name and UPC are printed on the packaging.

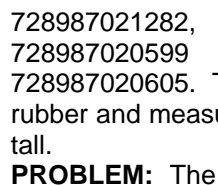

The Artiste's UPC is 728987021282, the Volume style's UPC is 728987020599 and the Panic style's UPC is 728987020605. The pacifiers are plastic and silicone rubber and measure about 2 inches wide and 1½ inches tall.

PROBLEM: The pacifiers fail to meet federal safety standards. The beard on the Artiste and the knob on the Volume pacifiers can detach, posing a choking hazard to young children. In addition, the ventilation holes on the Volume and Panic pacifier guards are too small.

REMEDY: Consumers should immediately take the recalled pacifiers away from young children and return them to Fred & Friends for a \$12 refund. Fred & Friends is providing a postage paid envelope for consumers to return the recalled pacifiers. Contact Fred & Friends at (855) 346-6372 from 8 a.m. to 5 p.m. Monday through Friday, email the firm at pacifiersconsumer@fredandfriends.com or online at

www.fredandfriends.com and click on Pacifier Recall for more information.

PRODUCT/FIRM: Britax B-Agile, B-Agile Double and BOB Motion strollers

BRAND/MODEL: This recall involves Britax B-Agile, B-Agile Double and BOB Motion strollers. The single and double strollers were sold in various color schemes, including black, red, kiwi, sandstone, navy and orange. They were manufactured between March 2011 and June 2013 and have the following model numbers: U341763, U341764, U341782 and U341783 for the B-Agile strollers;



U361818 or U361819 for the B-Agile Double strollers; and U391820, U391821 and U391822 for the BOB Motion strollers. The model number and the manufacture date in YYYY/MM/DD format can be found on label located on the inside of the stroller's metal frame near the right rear wheel.

PROBLEM: The hinge on the stroller's folding mechanism can partially amputate consumers' fingertips, break their fingers or cause severe lacerations, among other injuries, when they press the release button while pulling on the release strap.

REMEDY: Consumers should stop using the recalled strollers immediately and contact Britax to receive a free repair kit. Contact Britax at (866) 204-1665 from 8:30 a.m. to 6:00 p.m. Monday through Thursday and 8:30 a.m. to 5:00 p.m. Friday, visit the company's websites at www.britaxusa.com or www.bobgear.com and click on "Safety Notice" at the top right corner or on "Learn More" at the bottom center of the page, or e-mail strollerrecall@britax.com for more information.

PRODUCT/FIRM: Runway Global Girls' Sugarfly Hooded Jackets

BRAND/MODEL: This recall involves three styles of Sugarfly-branded



hooded, woven cotton and woven polyester jackets for girls with a drawstring through the hood. Style number KMCBJ255 is olive and

has a zipper closure and four front pockets with buttons, plus two zipper pockets. Style number KMCBJ410 is a belted, double-breasted, French coat style white garment with faux fur around the neck. Style KMCBJ421 is fuchsia or purple and has a button closure, plus snap button pockets on each side. They were sold in girl's sizes 7 through 16. The style number can be found on the back of the sewn-in neck label.

PROBLEM: The jackets have drawstrings in the hood around the neck area that pose a strangulation hazard to young children. In February 1996, CPSC issued guidelines about drawstrings in children's upper outerwear. In 1997, those guidelines were incorporated into a voluntary standard. Then, in July 2011, based on the guidelines and voluntary standard, CPSC issued a federal regulation.

REMEDY: Consumers should immediately take the garments away from children. Consumers can remove the drawstrings to eliminate the hazard or return the garments to Burlington Coat Factory for a full refund. Contact Runway Global at (855) 248-1566, from 9 a.m. to 5 p.m. Monday through Friday, online at www.sugarfly.us and click on "Sugarfly Girls" on the top bar and then click on "Recall Info" at the bottom of the page, or e-mail to willa@runwayglobal.com for more information.

PRODUCT/FIRM: BebeLove Baby Walkers

BRAND/MODEL: The recalled includes all BebeLove walkers that were sold for babies age 6 months or older. The walkers contain a plastic-covered foam padded seat with a plastic base and toy tray. Model 358 walkers have a green, pink or orange musical tray with a white toy bar and solid colored seats. Model 368 walkers have green, pink or white musical tray with a yellow toy bar and printed patterned seats. Both models have white stoppers on the bottom of the base of the walker and model numbers printed on a label on the rear bottom inside of the base. "BEBELOVE" is printed on a label on the seat back and on the base of the walkers.

PROBLEM: The walkers failed to meet federal safety standards. Specifically, style number 358 can fit through a standard doorway and is not designed to stop at the edge of a step as required by the federal safety standard. In addition, style number 368 contains leg openings that allow the child to slip down until the child's head can become entrapped at the neck. Babies using these walkers can be seriously injured or killed.

REMEDY: Consumers should stop using the recalled baby walkers immediately and contact BebeLove for a free repair kit. Contact BebeLove at (888) 464-1218 from 9 a.m. to 5 p.m. Monday through Friday or online at www.bebeloveusa.com and click on "Recall Contact" for more information.

PRODUCT/FIRM: U.S. Polo Assn. Girl's Jacket

BRAND/MODEL: This recall involves U.S. Polo Assn. girl's jackets. The jackets



have the name U.S. Polo Assn. with the year 1890 and crossed polo mallets on the jacket's upper right exterior and a silhouette of two polo players and the initials USPA on the

jacket's upper left exterior. The jackets come in the colors fuchsia, green and cream in girl's sizes 4-16. The name Q4 Designs LLC and style numbers can be found on the white tracking label tag sewn into the inside of the jacket near the waist band. Recalled style numbers include: U274-200 for sizes 4-6 and U274-300 for sizes 7-16.

PROBLEM: The jackets have a band of material at the neck that can pose a strangulation hazard to young children. In February 1996, CPSC issued guidelines about drawstrings in children's upper outerwear. In 1997, those guidelines were incorporated into a voluntary standard. Then, in July 2011, based on the guidelines

and voluntary standard, CPSC issued a federal regulation.

REMEDY: Consumers should remove or cut the band to eliminate the hazard, or contact Q4 Designs to obtain a full refund. Contact Q4 Designs LLC at (800) 741-0127 from 9 a.m. to 5 p.m. or online at www.q4designs.com and click on Product Recall for more information.

QUESTIONS?

Joshua Hollins
Office of the Attorney General
Consumer Protection Section
P.O. Box 94005
Baton Rouge, LA 70804-9005
(225) 326-6400 (phone)
www.agbuddycaldwell.com
hollinsj@ag.state.la.us

For information on the new crib safety standards, please visit www.cpsc.gov.

To join the Safety Box Mailing List, contact the Department of Social Services (DSS) at (225) 342-9905.

Note: The daycare facility must be registered with DSS to join the Safety Box Mailing List.

This public document is published at a total cost of \$2,716.09. Two thousand one hundred and fifty (2,150) copies of this public document were published in this first printing at a cost of \$1,429.17. The total cost of all printings of this document including reprints is \$2,716.09. This document was printed for the Louisiana Department of Justice by Employment Development Services, Inc., P.O. Box 15447, Baton Rouge, Louisiana 70895-5447 to educate consumers on child safety recalls. This material was printed in accordance with standards for printing by state agencies established pursuant to R.S. 43:31. Printing of this material was purchased in accordance with the provisions of Title 43 of the Louisiana Revised Statutes.

**Louisiana Attorney General's Office
Public Protection Division
Consumer Protection Section
P.O. Box 94005
Baton Rouge, LA 70804-9005**



*The Safety Box
Winter 2013*

*A newsletter dedicated to keeping our
children safe.*